

**App. A:  
Bolcome Decl., Ex. 8.i  
Part IV**

1. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700  
 GENERAL CONDITION: GOOD R #: 00000  
 OUTSIDE WORK: NO DATE: 3-1-71  
 FROM: GLOBE #10  
 FIRED AMMO TYPE: - TUCSON, ARIZONA  
 & CONDITION: \_\_\_\_\_ GUN #: 6319824  
 PROOF: R.E.P. E INSP.: 58 TEST: NO STAMP CODE: AT= 3/70  
 HEADING: O.K. GA./CAL.: 270 WIN.  
 BREECH OPENING: - CHECKED BY: C. P. [signature]  
 RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
 CHAMBER: O.K. APPROVED: \_\_\_\_\_  
 TEST: NO APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO COMPONENT DAMAGED OR BROKEN. TRIGGER-CONNECTOR  
SEAR ENGAGEMENT = .005 (MIN. IS .013)

COMPLAINT: FIRES ON CLOSING BOLT

INCIDENT: FOLLOW DOWN

COMMENTS: THE TRIGGER CONNECTOR-SEAR ENGAGEMENT IS  
NOT ENOUGH FOR PROPER SUPPORT, ALLOWING THE  
FIRING PIN TO FOLLOW DOWN.

PLAINTIFF'S  
EXHIBIT

3280

AL 0029812

10 of 1

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700GENERAL CONDITION: GOOD R #: 03978OUTSIDE WORK: NO DATE: 3-1-71FROM: ERBACHERS SPORTS CENTERFIRED AMMO TYPE: - MADISON, OHIO.& CONDITION: \_\_\_\_\_ GUN #: 278328PROOF: R.E.P. INSP.: D TEST: 87 CODE: CP-4/87HEADING: O.K. GA./CAL.: 7MM MAG.BREACH OPENING: - CHECKED BY: C.P.RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO COMPONENT DAMAGE OR BREAKAGE.COMPLAINT: "FIRED TWO TIMES WHEN CLOSING BOLT."INCIDENT: FOLLOW DOWNPLAINTIFF'S  
EXHIBIT  
3281

COMMENTS: TRIGGER CONNECTOR-SEAR ENGAGEMENT. 025. THE  
TRIGGER ETC. WAS FOUND TO BE COATED WITH A HEAVY-  
GREASE-LIKE LUBRICANT WHICH WOULD CAUSE TRIGGER  
RETRACTION TO BE ERRATIC. THIS APPARENTLY HAPPENED  
TO THE CUSTOMER - TRIGGER DID NOT RETRACT AND  
WHEN THE BOLT WAS CLOSED THE FIRING PIN  
FOLLOWED DOWN.

AL 0029813

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_MODEL: 700 BDLGENERAL CONDITION: GOODR # : 01780OUTSIDE WORK: SCOPE MOUNTED, REAR SIGHTDATE: 1-26-71LEAF REMOVED.FROM: GREEN BROOK, N.J.

FIRED AMMO TYPE: \_\_\_\_\_

GREEN BROOK, N.J.

&amp; CONDITION: \_\_\_\_\_

GUN # : 6362025PROOF: R.E.P.-E INSP.: 74TEST: 87CODE: WT = 8/70HEADING: O.K.GK./CAL.: 7MM. MOD.

BREECH OPENING: \_\_\_\_\_

CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K.

APPROVED: \_\_\_\_\_

CHAMBER: O.K.

APPROVED: \_\_\_\_\_

TEST: NO

APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: \_\_\_\_\_

COMPONENTS O.K.COMPLAINT: "UPON RELEASING THE SAFETY MAY FIRE"INCIDENT: FOLLOW DOWN

PLAINTIFF'S EXHIBIT 3282
--------------------------------

COMMENTS: THE MALFUNCTION CAN NOT BE DUPLICATED,  
HOWEVER, THE SEAR-CONNECTOR ENGAGEMENT IS NOT  
TO SPECIFICATION (.008 SHOULD BE .015 MIN.) THIS COUPLED  
WITH ANY TRIGGER BIND, SUCH AS TOO HEAVY LUBRICANT,  
MIGHT CAUSE A MALFUNCTION. ENGAGEMENT  
CORRECTED.

1 of 1

AL 0029814



1. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700

GENERAL CONDITION: NEW R #: 29996

OUTSIDE WORK: FRONT TRIGGER ADJUSTING DATE: 1-4-71

SEAR WAS RE-ADJUSTED. FROM: LEFAYETTE S&S

FIRED AMMO TYPE: - WINCHESTER .22

& CONDITION: DISSEMBLED IS GUN #: 6329151

PROOF: P.E.R.F. INSP.: 0 TEST: 98 CODE: DT-9170

HEADING: O.K. GRA./CAL.: 3006

BREECH OPENING: - CHECKED BY: C. PROFFER

RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_

CHAMBER: O.K. APPROVED: \_\_\_\_\_

TEST: N.C. APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO DAMAGED OR BROKEN PARTS.

COMPLAINT: "SEVERAL TIMES GUN WENT OFF WHEN CLOSING BOLT."

INCIDENT: FOLLOWS DOWN

COMMENTS: SEAR-TRIGGER CONNECTOR ENGAGEMENT .005,

MINIMUM IS .015. THIS LETS THE SEAR SLIP OFF THE

CONNECTOR UNDER PRESSURE AND FELL ON DOWN

RESULTS.

PLAINTIFF'S  
EXHIBIT

3283

1 of 1

AL 0029815

*Customer Complaint*P.I. No GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDLGENERAL CONDITION: USED-GOOD R #: 00931OUTSIDE WORK: SCOPE MOUNTED DATE: 1-12-71FROM: JOHN M. ANGELOFIRED AMMO TYPE: \_\_\_\_\_ LANSING, MICH.& CONDITION: \_\_\_\_\_ GUN #: 247248PROOF: R.E.R. INSP.: D TEST: 87 CODE: EN= 10/66HEADING: O.K. GA./CAL.: 3006 SPR.BRESCH OPENING: \_\_\_\_\_ CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO BROKEN COMPONENTS.COMPLAINT: FIRED AS BOLT WAS PULLED HALF WAY UP.INCIDENT: APPARENTLY TRIGGER FAILED TO RETRACT.PLAINTIFF'S  
EXHIBIT

3284

COMMENTS: TRIGGER-CONNECTOR-SEAR ENGAGEMENT .020,NO INTERFERENCE INDICATED AND MALFUNCTION NOTDUPLICATED. SOME EVIDENCE OF TOO HEAVY ALUBRICANT BEING USED. SUGGEST CLEANING ANDINFORMING CUSTOMER HE SHOULD USE VERY LIGHTOR NO LUBRICANT.

AL 0029816

1 of 1

AL-100-7-17-1

# Customer Complaint

MODEL: 700  
R # : 2400  
DATE: 10-2-70  
FROM: FLA. ARMS. CO.  
FIRED AND TYPE: 1000  
CONDITION: GOOD  
GUN # : 683485  
CODE: CF-40  
PRECIP: 2.5 INSP.: 1 TEST: 1  
HEADING: 0.0 GA/CAL.: 25.0  
BREACH OPENING: 1 CHECKED BY: C. F. CO.  
RECOIL SHOULDERS: 1 APPROVED: 1  
CHAMBER: 0.0 APPROVED: 1  
TEST: NO APPROVED: 1  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: 1

COMPLAINT: BULLET STICKS IN CHAMBER ALSO BOLT IS  
IMMOVABLE FOR SOME REASON.

INCIDENT: 1

PLAINTIFF'S  
EXHIBIT  
3286

COMMENTS: THE CUSTOMER PULLED THE BULLET OUT OF THE  
CASE LEAVING IT IN THE THROAT. THIS APPARENTLY  
IS AN AMMUNITION PROBLEM (PER M. WALKER).  
THE BOLT CATCHING IS CAUSED BY PUSHING THE  
SAFETY ON BEFORE LOCKING THE BOLT THUS CATCH-  
ING THE SAFETY PIN IN THE LOCKING CAM.

1 of 1  
AL (X)29819



P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL  
GENERAL CONDITION: NEW R #: 23406  
OUTSIDE WORK: NO DATE: 11-2-70  
FROM: OCONTO, WIS.  
FIRED AMMO TYPE: -  
& CONDITION: \_\_\_\_\_ GUN #: 6248578  
PROOF: - INSP.: \_\_\_\_\_ TEST: \_\_\_\_\_ CODE: PS-6/69  
HEADING: - GA./CAL.: 7MM  
BREECH OPENING: - CHECKED BY: C. PROSSER  
RECOIL SHOULDERS: - APPROVED: \_\_\_\_\_  
CHAMBER: - APPROVED: \_\_\_\_\_  
TEST: NO APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

TRIGGER CONNECTOR BROKEN.

COMPLAINT: FIRES WHEN SAFE IS REMOVED & WONT COCK  
AT TIMES.

INCIDENT: \_\_\_\_\_

COMMENTS: MALFUNCTION WAS CAUSED BY THE BROKEN  
TRIGGER CONNECTOR.

PLAINTIFF'S  
EXHIBIT

3287

1 of 1

AL 0629820



MC-55 Rev. 2-15-61

*Customer Complaint*

P.I. MC GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_

MODEL: 707 12.1

GENERAL CONDITION: NEW

R # : 2227

OUTSIDE WORK: NO

DATE: 11-7-77

FROM: SHAR: H&H

FIRED AMMO TYPE: -

FLAME-11

& CONDITION: \_\_\_\_\_

GUN # : 6211234

PROOF: REP

INSP: 7-1

P. 2M. 7-1

TEST: \_\_\_\_\_

CODE: BT-1/70

HEADING: O.K.

GA./CAL.: 3006

BREACH OPENING: -

CHECKED BY: C. ROOPER

RECOIL SHOULDERS: O.K.

APPROVED: \_\_\_\_\_

CHAMBER: \_\_\_\_\_

APPROVED: \_\_\_\_\_

TEST: NO

APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: \_\_\_\_\_

REP-O.K.

COMPLAINT: "EVERY TIME YOU PUSH THE PISTON UP THE  
RIFLE FIRES."

INCIDENT: FOLLOWS DOWN

COMMENTS: THE ENGAGEMENT OF THE SEAR, TRIGGER CON-  
NECTOR SET TOO CLOSE AT FINAL ASSEMBLY. (00542)

PLAINTIFF'S  
EXHIBIT

3288

AL 0029821

*Custom Complaints*1. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_MODEL: 700 ADLGENERAL CONDITION: NEWR #: 26143OUTSIDE WORK: NODATE: 11-12-70FROM: DAKIN SPTG. CO., CO.FIRED AMMO TYPE: -BANGOR, MAINE

&amp; CONDITION: \_\_\_\_\_

GUN #: 6219140PROOF: R.E.P. INSP.: \_\_\_\_\_TEST: 41 ASSEMBLERCODE: LS-2/69HEADING: O.K.GAZ/CAL.: 3006BREACH OPENING: -CHECKED BY: C. PROSSERRECOIL SHOULDERS: -

APPROVED: \_\_\_\_\_

CHAMBER: O.K.

APPROVED: \_\_\_\_\_

TEST: NO

APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: \_\_\_\_\_

TRIGGER CONNECTOR BROKEN.COMPLAINT: "WILL NOT STAY COCKED"INCIDENT: FOLLOWS DOWNCOMMENTS: THE BROKEN CONNECTOR MAKES RETRACTION  
UNDER SEAR UNCONTROLLABLE. THE CONNECTOR  
FAILING TO RETRACT CAUSES FOLLOW DOWN.PLAINTIFF'S  
EXHIBIT

3289

1 of 1

AL 0029822

Customer Complaint

P.I. AD GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL  
 GENERAL CONDITION: NEW R #: 26910  
 OUTSIDE WORK: NO DATE: 11-17-70  
 FROM: GOLD BUSH SALES  
 FIRED AMMO TYPE: - BROOKLYN, N.Y.  
 & CONDITION: \_\_\_\_\_ GUN #: 6288540  
 PROOF: R.E.P. INSP. ASSEMBLER #30 TEST: 79 CODE: C5-4/69  
 HEADING: O.K. GA./CAL.: 3006  
 BREECH OPENING: - CHECKED BY: C. PROSSER  
 RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
 CHAMBER: O.K. APPROVED: \_\_\_\_\_  
 TEST: NO APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_  
COMPONENTS O.K.

COMPLAINT: FIRE UPON CLOSING BOLT.INCIDENT: APPARENTLY FOLLOWED DOWN.

COMMENTS: ENGAGEMENT O.K. NO REASON FOR MALFUNCTION  
COULD BE FOUND. THE MALFUNCTION COULD  
NOT BE REPRODUCED.

PLAINTIFF'S  
EXHIBIT

3290

1 of 1  
AL 0029823

Customer Complaint

A  
STYLING POSITION: \_\_\_\_\_  
GUN # : \_\_\_\_\_  
DATE: \_\_\_\_\_  
FROM: \_\_\_\_\_  
FIELD NO. & TYPE: \_\_\_\_\_  
& CONDITION: \_\_\_\_\_  
GUN # : \_\_\_\_\_  
PROOF: \_\_\_\_\_ INSP.: \_\_\_\_\_ TEST: \_\_\_\_\_  
CODE: \_\_\_\_\_  
HEADING: \_\_\_\_\_  
GAT./CAL.: \_\_\_\_\_  
BREECH OPENING: \_\_\_\_\_  
CHECKED BY: \_\_\_\_\_  
RECOIL SHOULDERS: \_\_\_\_\_  
APPROVED: \_\_\_\_\_  
CHAMBER: \_\_\_\_\_  
APPROVED: \_\_\_\_\_  
TEST: \_\_\_\_\_  
APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) \_\_\_\_\_  
APPROVED: \_\_\_\_\_

NO PROBLEM OR DEFECTIVE COMPONENTS.

COMPLAINT: GUN FIRES WHEN BOLT IS CLOSED.

INCIDENT: FOLLOWS DOWN

COMMENTS: THE SEAR-CONNECTOR ENGAGEMENT WAS  
SET TOO CLOSE BY FINAL ASSEMBLY.

PLAINTIFF'S  
EXHIBIT

3291

1 of 1

AL 0029824



*Custom Complaint*P.T. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL.GENERAL CONDITION: GOOD R #: 27632OUTSIDE WORK: STOCK BEDDING ALTERED. DATE: 12-3-70SCOPE MOUNTED. FROM: R. ROYSEFIRED AMMO TYPE: - PORTLAND, OREGON.& CONDITION: \_\_\_\_\_ GUN #: 6275235PROOF: R.F.P. INSP.: 9 ASSEMBLER 90 TEST: 55 CODE: ES-10/69HEADING: O.K. GA./CAL.: 7MM REV. 44...BREACH OPENING: - CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: No APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

COMPLAINT: POOR GROUPS, FIRED WHEN SAFETY WAS PUSHED TO FIRE POSITION.INCIDENT: BARREL BORE ROUGH, FOLLOWED DOWN.COMMENTS: THE FOLLOWING DOWN CAN NOT BE DUPLICATED.  
BARREL BORE EXCESSIVELY ROUGH - SHOULD BE REPLACED.PLAINTIFF'S  
EXHIBIT  
3292

AL 0029825

# Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL  
 GENERAL CONDITION: NEW R #: 27297  
 OUTSIDE WORK: NO DATE: 11-23-70  
 FROM: SINGLE ELEC. CO.  
 FIRED AMMO TYPE: - VERNAL, U.S.M.  
 & CONDITION: \_\_\_\_\_ GUN #: 6296877  
 PROOF: R.E.P.A INSP: 74 TEST: 55 CODE: LT = 2/70  
 HEADING: - GA./CAL.: 3006  
 BREACH OPENING: - CHECKED BY: C. PROSSER  
 RECOIL SHOULDERS: - APPROVED: \_\_\_\_\_  
 CHAMBER: - APPROVED: \_\_\_\_\_  
 TEST: NO APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

TRIGGER CONNECTOR CLEARANCE -.003 OUTSIDE MODEL  
 DRAWING; CONNECTOR TRIGGER CLEARANCE +.005 OUTSIDE  
 MODEL DRAWING. THIS ADDS UP TO .009 MORE MOVE-  
 MENT UP OF CONNECTOR THAN THERE SHOULD BE TO  
 POSSIBLE INTERFERENCE WITH THE SEAR.

COMPLAINT: "TRIGGER FIRES SOMETIMES WHEN TAKEN OFF  
SAFE." (EXTRACTOR FAULTY)

INCIDENT: FOLLOWS DOWN WHEN SAFE IS PUSHED OFF.

COMMENTS: THE FALLING DOWN MALFUNCTION COULD NOT  
BE VERIFIED ALTHOUGH EXCESSIVE CONNECTOR  
MOVEMENT IS PRESENT.

EXTRACTOR CLAW DAMAGED.

PLAINTIFF'S  
EXHIBIT  
3293

1 of 1

AL 0029826

*Customer Complaint*P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700GENERAL CONDITION: NEW R #: 27774OUTSIDE WORK: NO DATE: 12-10-70FIRED AMMO TYPE: - FROM: KROEGGER'S FARM& CONDITION: \_\_\_\_\_ SUPPLY DURANGO, COL.PROOF: R.E.A.A. INSP.: 318 TEST: 13 GUN #: 6367225HEADING: - CODE: DT-9/70BREECH OPENING: - G.K./CAL.: 3006RECOIL SHOULDERS: - CHECKED BY: C. PROSSERCHAMBER: - APPROVED: \_\_\_\_\_TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

COMPONENTS D.K.COMPLAINT: "HAMMER IN BOLT WILL NOT STAY COCKED."INCIDENT: FOLLOWS DOWN.COMMENTS: SEAR, TRIGGER CONNECTOR, ENGAGEMENT  
ADJUSTED TOO CLOSE (.005) MINIMUM IS .015, THIS  
LETS THE SEAR SLIP OFF THE CONNECTOR UNDER  
PRESSURE & FIRING PIN FOLLOWS DOWN.RE-ADJUSTED ENGAGEMENT.PLAINTIFF'S  
EXHIBIT

3294

1 of 1  
AL 0029827



*Customer Complaint*

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL  
 GENERAL CONDITION: GOOD R #: 29327  
 OUTSIDE WORK: EXTRACTOR RIFLE - GROUND DEF. DATE: 12-15-70  
TRIGGER ADJUSTED - EMERGENCY SCREEN FROM: HARDER S-T. GUN  
APPEARS UNTOUCHED. FIRED AMMO TYPE: — WILLIAMSPOOT - FR.  
 & CONDITION: \_\_\_\_\_ GUN #: 6252772  
 PROOF: R.E.F.E INSP.: 17 TEST: 55 CODE: 45-8/10  
 BENDING: — L.A./C.M.: —  
 BREACH OPENING: — CHECKED BY: C. PROSSER  
 RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
 CHAMBER: O.K. APPROVED: \_\_\_\_\_  
 TEST: No APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_  
NO DEFECTIVE OR BROKEN COMPONENTS.

COMPLAINT: "FIRED UPON CLOSING"INCIDENT: FOLLOWED DOWN

COMMENTS: SEAL-CONNECTOR ENGAGEMENT .003, MINIMUM IS .015,  
THIS LETS THE SEAL SLIP OFF THE CONNECTOR UNDER  
PRESSURE AND FOLLOW DOWN. RESULTS.

PLAINTIFF'S  
EXHIBIT

3295

AL 0029828

1 of 1



P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 BDL  
 GENERAL CONDITION: NEW R #: 29277  
 OUTSIDE WORK: NO DATE: 12-21-70  
 FROM: LEONARD  
 FIRED AMMO TYPE: - FAST-WORTH, TEX.  
 & CONDITION: \_\_\_\_\_ GUN #: 333-472  
 PROCP: RFP INSP.: 4 TEST: 49 CODE: WT = 8/70  
 HEADING: O.K. GA./CAL.: 270 WIN.  
 BREACH OPENING: - CHECKED BY: C. F. ROSSER  
 RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
 CHAMBER: O.K. APPROVED: \_\_\_\_\_  
 TEST: NO APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

SAFETY CAN REPORT OFF OF SEAR.

COMPLAINT: 'SAFETY DOES NOT WORK'

INCIDENT: FIRING WITH "SAFE"

REMARKS: SAFETY CAN NOT FUNCTION WITHOUT THE CAN ON THE SEAR- SAFETY CAN.

PLAINTIFF'S  
EXHIBIT  
3296

10/1  
AL 0029829

RE-55-1 Rev. 2-15-61

P.I. 177 GUN EXAMINATION REPORT NUMBER:                      MODEL: 700 S&W

GENERAL CONDITION: GOOD R # : 2572

OUTSIDE WORK: NO DATE: 12-21-72

FROM: AL. M. ...

FIRE ARM TYPE:                      DETENT LOCK

& CONDITION:                      GUN # : 5-7-102

PROOF: R.F. INSP.:                      TEST: ✓ CODE: 22-1710

HEADING: C.H. GR./CAL.: 30 MIN. ...

BRECK OPENING:                      CHECKED BY: C. PROSE

RECOIL SHOULDERS:                      APPROVED:                     

CHAMBER: O.K. APPROVED:                     

TEST: NO APPROVED:                     

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED:                     

COMPLAINT: "GUN FIRED WHEN PICKED UP"

INCIDENT: FOLLOWING ...

COMMENTS: TRIGGER CONNECTOR - SEAR ENGAGEMENT DID  
MIN. ENGAGEMENT = .015. MALFUNCTION NOT DUPLICATED.  
ENGAGEMENT RE-ADJUSTED.

PLAINTIFF'S  
EXHIBIT

3297

AL 0029830

*Customer Complaint*P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 ADLGENERAL CONDITION: NEW R #: 00285OUTSIDE WORK: NO DATE: 1-6-71FIRED AMMO TYPE: - FROM: K MART SPTB, DEL& CONDITION: \_\_\_\_\_ GUN #: 6248840PROOF: R.E.P. INSP: \_\_\_\_\_ TEST: \_\_\_\_\_ CODE: P.S. = 6/69HEADING: O.K. GRA./CAL.: 7MM REM.BREECH OPENING: - CHECKED BY: C. PROSSERRECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

BROKEN TRIGGER CONNECTORCOMPLAINT: DEFECTIVEINCIDENT: FOLLOWS DOWNCOMMENTS: THE BROKEN TRIGGER CONNECTOR FAILS TO  
RETRACT TO SUPPORT THE SEAR IN COCKED POSI-  
TION. WITHOUT SUPPORT, THE SEAR FOLLOWS DOWN.PLAINTIFF'S  
EXHIBIT

3298

AL 0029831

*Customer Complaint*P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700GENERAL CONDITION: USED R #: 00598OUTSIDE WORK: NO DATE: 1-11-71FIRED AMMO TYPE: \_\_\_\_\_ FROM: REM. ARMS OF CAN.& CONDITION: \_\_\_\_\_ TORONTO, ONT., CANADAPROOF: R.E.P. ASSEMBLER # 64 GUN #: 6216023HEADING: \_\_\_\_\_ CODE: LS-2/69BREACH OPENING: \_\_\_\_\_ OK./CAL.: 350 REM. MAG.

RECOIL SHOULDERS: \_\_\_\_\_ CHECKED BY: \_\_\_\_\_

CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: No APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

NO BROKEN COMPONENTS.COMPLAINT: SEAR WILL NOT HOLD.INCIDENT: FOLLOW DOWN.COMMENTS: SEAR-TRIGGER CONNECTOR ENGAGEMENT O.K.; MAL-FUNCTION COULD NOT BE DUPLICATED; HOWEVER BRIGHT  
EDGE ON TRIGGER (TOP) INDICATES A SLIGHT INTERFER-  
ENCE WHICH MAY HAVE CAUSED THE MALFUNCTION.PLAINTIFF'S  
EXHIBIT

3299

AL 0029832



11-552-1 Rev. 2-15-61

*M/700 Fire Control*

*NE* GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 PDL  
GENERAL CONDITION: Good R #: 22750  
OUTSIDE WORK: ADD TRIGGER ADJUSTMENT DATE: 10-16-70  
SCREWS UNSEALED, ADJUSTMENTS CHANGED FROM: CENTRALIA  
FIRED AMMO TYPE: - 164 INCHES  
& CONDITION: \_\_\_\_\_ GUN #: 193517  
PROOF: R.E.P. INSP.: 7 TEST: \_\_\_\_\_ CODE: WTS = 5/75  
HEADING: \_\_\_\_\_ GA./CAL.: 22E  
BREECH OPENING: \_\_\_\_\_ CHECKED BY: C.F. D. S. D. R.  
RECOIL SHOULDERS: \_\_\_\_\_ APPROVED: \_\_\_\_\_  
CHAMBER: \_\_\_\_\_ APPROVED: \_\_\_\_\_  
TEST: \_\_\_\_\_ APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_  
OLD STYLE SEAR SAFETY SW. HEAVY ON UP  
TRIGGER CONNECTOR BROKEN  
COMPLAINT: FOLLOWS DOWN  
INCIDENT: \_\_\_\_\_  
COMMENTS: FOLLOW DOWN WAS CAUSED BY THE BROKEN CONNECTOR



AL 0029841

NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700  
 GENERAL CONDITION: NEW R #: 22775  
 OUTSIDE WORK: No DATE: 10-15-70  
 FIRED AMMO TYPE: \_\_\_\_\_ FROM: MARKLEYSBURG, PA.  
 & CONDITION: \_\_\_\_\_ GUN #: 6262918  
 PROOF: R.E.P. INSP.: 9 TEST: \_\_\_\_\_ CODE: 05 = 7/69  
 HEADING: O.K. GA./CAL.: 22-250  
 BREACH OPENING: \_\_\_\_\_ CHECKED BY: C. PROSSER  
 RECOIL SHOULDERS: \_\_\_\_\_ APPROVED: \_\_\_\_\_  
 CHAMBER: \_\_\_\_\_ APPROVED: \_\_\_\_\_  
 TEST: FUNCTION ONLY APPROVED: \_\_\_\_\_  
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

COMPLAINT: FOLLOWS DOWN WHEN SAFETY IS PUSHED OFF.

INCIDENT: \_\_\_\_\_

COMMENTS: THE DIMENSION FROM THE TOP OF THE TRIGGER TO  
 CENTER OF TRIGGER PIN HOLE BEING .011 OVERSIZE  
 ELIMINATES MOST OF THE CLEARANCE NEEDED FOR THE  
 TRIGGER-CONNECTOR TO RETRACT WITH THE SAFETY ON



AL 0029842

RD-6542-1 Rev. 2-15-61

P NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700 ADL

GENERAL CONDITION: NEW R #: 22730

OUTSIDE WORK: NO DATE: 10-16-70

FROM: LIVONIA, MICH.

FIRE AMMO TYPE: \_\_\_\_\_

& CONDITION: \_\_\_\_\_ GUN #: 6278113

PROOF: R.E.P. INSP: \_\_\_\_\_ TEST: \_\_\_\_\_ CODE: \_\_\_\_\_

HEADING: \_\_\_\_\_ GA./CAL.: 3006

BREECH OPENING: \_\_\_\_\_ CHECKED BY: C. PROSSER

RECOIL SHOULDERS: \_\_\_\_\_ APPROVED: \_\_\_\_\_

CHAMBER: \_\_\_\_\_ APPROVED: \_\_\_\_\_

TEST: FUNCTION ONLY APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

CONNECTOR IS .005 UNDERSIZE ON 1.080 DIMENSION (TRIGGER CLEARANCE)

COMPLAINT: FOLLOWS DOWN

INCIDENT: \_\_\_\_\_

COMMENTS: CONNECTOR BEING TIGHT ON TRIGGER DID NOT RETRACT, ACTION WOULD NOT COCK. AS LONG AS THE CONNECTOR STAYED IN POSITION ON THE TRIGGER THE RIFLE WOULD WORK O.K.



AL 0029843



P.T. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700GENERAL CONDITION: GOOD R #: 21196OUTSIDE WORK: SCOPE MOUNTED DATE: 10-2-70FIRED AMMO TYPE: \_\_\_\_\_ FROM: DAVISON& CONDITION: \_\_\_\_\_ MICHIGANPROOF: R.E.P. INSP: 9 TEST: 87 GUN #: 6216922HEADING: O.K. CODE: LS = 2/69BREECH OPENING: \_\_\_\_\_ GA./CAL.: 243 WIN.

RECOIL SHOULDERS: \_\_\_\_\_ CHECKED BY: \_\_\_\_\_

CHAMBER: O.K. APPROVED: \_\_\_\_\_TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

TRIGGER CONNECTOR BROKEN.COMPLAINT: FIRING PIN FOLLOWS DOWN

INCIDENT: \_\_\_\_\_

COMMENTS: THE CONNECTOR BEING BROKEN, ENGAGEMENTBETWEEN IT AND THE SEAR WAS UNLIKELY THEREFORE  
THE FIRING PIN WAS FREE TO FOLLOW DOWN.

AL 0029844